



Bulletin No.: PIT5774A

Published date: N/A

## Preliminary Information

### PIT5774A Overhead Roof Console Inoperative / Service Safety Restraints Message / Sunroof Inoperative / Dome Lights Inoperative / DTCs B1A7A and U1121

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Suburban	2021	All	All	All	All
Chevrolet	Tahoe	2021	All	All	All	All
GMC	Yukon Models	2021	All	All	All	All

Involved Region or Country	North America
Condition	<p>Some customers may comment on the following complaints:</p> <ul style="list-style-type: none"> <li>- Service Safety Restraints System Message</li> <li>- Sunroof Inoperative</li> <li>- Sunshade Lights Inoperative</li> <li>- Dome Lights Inoperative</li> <li>- Power Liftgate Inoperative when using switch in overhead console</li> </ul> <p>When the vehicle is checked for DTC's there will be a current U1121 set in the BCM and B1A7A set in the Restraints Module.</p>
Cause	The cause of these concerns could be the Roof Console A103.

#### Correction:

Engineering has released updated Roof Consoles to correct these concerns. Replace the A103 Roof Console with an updated part number listed in the parts section below.

#### Parts Information

Part Number	Description	QTY
85164174	Roof Console - Black	1
84164173	Roof Console - Dk Atmosphere	1
84164172	Roof Console - Gideon	1

#### Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Time
-----------------	-------------	------

1035580	Roof Console Replacement	Use published time
---------	--------------------------	--------------------

## Version History

Version	2
Modified	09/14/2020 - Created on. 07/26/2021 - Updated to Cause, Correction, Parts, and Warranty sections



© 2021 General Motors. All Rights Reserved.